Bell Helicopter TIEXTRON

Bell Helicopter Textron Inc. A Subsidiary of Textron Inc.

Post Office Box 482 Fort Worth, Texas 76101 (817) 280-2011

OPERATIONS SAFETY NOTICE

OSN-47-82-4

TO: OWNERS/OPERATORS OF ALL MODEL 47, H13, OH-13,

TH-13 AND ALL BELL MODEL HELICOPTERS USING ENGINE COOLING FAN DRIVE GEAR SETS, P/N

47-620-497-1

SUBJECT: AIRWORTHINESS OF FAN DRIVE GEAR SETS, P/N

47-620-497-1.

IN 1977, DURING OUR INVESTIGATION OF BOGUS PARTS IN ENGLAND, 314 ENGINE COOLING FAN DRIVE GEAR SETS, P/N 47-620-497-1 CONSISTING OF TWO (2) GEARS, P/N 47-620-530-1 AND 47-620-207-1 WERE REJECTED AS UNAIRWORTHY. THESE PARTS WERE IDENTIFIED BY SERIAL NUMBERS IN THE B12-16000 SERIES ON THE P/N 47-620-530-1 GEAR.

WESTLAND HELICOPTERS, YOVEL, ENGLAND, HAS ADVISED US OF TWO RECENT ACCIDENTS ATTRIBUTED TO FAILURE OF PARTS FROM THIS LOT AND OF THEIR EFFORT TO LOCATE THE REMAINING PARTS. WE HAVE LEARNED THAT SOME OF THESE PARTS HAVE FOUND THEIR WAY INTO THE UNITED STATES.

IN THE INTEREST OF FLIGHT SAFETY, USE OF THESE SERIAL NUMBERED PARTS SHOULD BE PROHIBITED. BELL HELICOPTER TEXTRON HAS SUBMITTED AN URGENT RECOMMENDATION TO THE FEDERAL AVIATION

ADMINISTRATION REQUESTING AN AIRWORTHINESS DIRECTIVE BE ISSUED REQUIRING REMOVAL FROM SERVICE AND PROHIBITING THE USE OF ANY GEAR SETS HAVING A B12-16000 SERIES SERIAL NUMBER ON THE P/N 47-620-530-1 GEAR.

OWNERS/OPERATORS OF MODEL 47 HELICOPTERS ARE ADVISED TO ASSURE THE AIRWORTHINESS OF PARTS USED ON THEIR EQUIPMENT.

IN ADDITION TO CONCERN ABOUT THE ABOVE FAN DRIVE GEAR SETS,
MODEL 47 OPERATORS SHOULD BE AWARE THAT OTHER "BOGUS" PARTS
ARE BEING DISCOVERED.